+ AUTODOC CLUB

How to change headlights on **TOYOTA Vios / Yaris II Saloon (XP9)** – replacement guide







SIMILAR VIDEO TUTORIAL



This video shows the replacement procedure of a similar car part on another vehicle

i Important!

This replacement procedure can be used for: TOYOTA Vios / Yaris II Saloon (XP9) 1.0 (KSP90_)

The steps may slightly vary depending on the car design.

This tutorial was created based on the replacement procedure for a similar car part on: TOYOTA Yaris II Hatchback (XP9) 1.3 VVT-i (SCP90_)


CLUB.AUTODOC.CO.UK 1–10







REPLACEMENT: HEADLIGHTS – TOYOTA VIOS / YARIS II SALOON (XP9). TOOLS YOU MIGHT NEED:

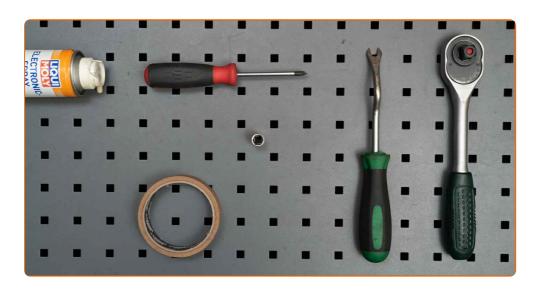

- Electronic spray
- Drive socket # 10
- Clip removal tool

- Ratchet wrench
- Phillips screwdriver
- Painter's tape

Buy tools

CLUB.AUTODOC.CO.UK 2-10







Replacement: headlights – TOYOTA Vios / Yaris II Saloon (XP9). Tip from AUTODOC:

- The replacement procedure is identical for the right and left headlight.
- Please note: all work on the car TOYOTA Vios / Yaris II Saloon (XP9) should be done with the engine switched off.

CARRY OUT REPLACEMENT IN THE FOLLOWING ORDER:

- Open the hood.
- Lift the car using a jack or place it over an inspection pit.
- Unscrew the lower fasteners of the bumper. Use a drive socket #10. Use a ratchet wrench.



Remove the side bumper retainer clips. Use a Phillips screwdriver. Use a clip removal tool.



CLUB.AUTODOC.CO.UK 3-10







Detach the lockers at the points where they are fastened to the bumper.



- 6 Lower the car.
- Remove the upper bumper retainer clips. Use a clip removal tool.



Stick painter's tape to the car fenders to protect the paintwork from damage when demounting the bumper.



Release the side clips of the bumper.

10



Carefully release the bumper from the fasteners.

CLUB.AUTODOC.CO.UK 4-10







11 Remove the bumper.



AUTODOC recommends:

- Replacement: headlights TOYOTA Vios / Yaris II Saloon (XP9). To avoid damaging the part when removing it, do not use excessive force.
- Unscrew the headlight fasteners. Use a drive socket #10. Use a ratchet wrench.



Unplug the connectors of the headlight bulbs.



14 Remove the headlight.



CLUB.AUTODOC.CO.UK 5-10

 






AUTODOC recommends:

 Replacement: headlights – TOYOTA Vios / Yaris II Saloon (XP9). Do not use excessive force when removing the part as this may damage it.





Treat the connectors of the headlights. Use electronic spray.



Plug in the connectors of the headlight bulbs.



18 Install the new headlight.



CLUB.AUTODOC.CO.UK 6-10







AUTODOC recommends:

- Replacement: headlights TOYOTA Vios / Yaris II Saloon (XP9). To avoid damaging the part during installation, do not use excessive force.
- Screw in the headlight fasteners. Use a drive socket #10. Use a ratchet wrench.



- Switch on the ignition.
- Check whether the headlights function properly.



- Switch off the ignition.
- 23 Install the bumper to the mounting seat.



CLUB.AUTODOC.CO.UK 7-10

 






AUTODOC recommends:

 Replacement: headlights – TOYOTA Vios / Yaris II Saloon (XP9). Do not use excessive force during installation. This may damage the part.





Install the upper bumper retainer clips.



- Lift the car using a jack or place it over an inspection pit.
- 27 Install the side bumper retainer clips.



CLUB.AUTODOC.CO.UK 8-10







Attach the lockers at the points where they are fastened to the bumper.



Remove the masking tape.



Screw in the lower fasteners of the bumper. Use a drive socket #10. Use a ratchet wrench.



- Lower the car.
- Close the hood.



VIEW MORE TUTORIALS

CLUB.AUTODOC.CO.UK 9-10





AUTODOC — TOP QUALITY AND AFFORDABLE CAR PARTS ONLINE



A GREAT SELECTION OF SPARE PARTS FOR YOUR CAR

HEADLIGHTS: A WIDE SELECTION

(i) DISCLAIMER:

The document contains only general recommendations that may be useful for you when you perform repair or replacement work. AUTODOC shall not be liable for any loss, injury, damage of property occurring in the repair or replacement process due to incorrect use or misinterpretation of the provided information.

AUTODOC shall not be liable for any possible mistakes and uncertainties in this guide. The information provided is for information purposes only and cannot replace advice from specialists.

AUTODOC shall not be liable for incorrect or hazardous usage of equipment, tools and car parts. AUTODOC strongly recommends to be careful and observe the safety rules when performing repair or replacement works. Remember: usage of low quality auto parts does not guarantee you the appropriate level of road safety.

© Copyright 2022 – All the contents of this website, in particular texts, photographs and graphics, are protected by copyright. All rights, including reproduction, publication, editing and translation rights, are reserved by AUTODOC GmbH.

CLUB.AUTODOC.CO.UK 10-10