- AUTODOC CLUB

How to change pollen filter on FORD Focus II Hatchback (DA_, HCP, DP) – replacement guide



SIMILAR VIDEO TUTORIAL



This video shows the replacement procedure of a similar car part on another vehicle


(i) Important!

This replacement procedure can be used for:

FORD Focus II Hatchback (DA_, HCP, DP) 1.6 TDCi, FORD Focus II Hatchback (DA_, HCP, DP) 2.0 TDCi, FORD Focus II Hatchback (DA_, HCP, DP) 1.6, FORD Focus II Hatchback (DA_, HCP, DP) 1.6 Ti, FORD Focus II Hatchback (DA_, HCP, DP) 2.0, FORD Focus II Hatchback (DA_, HCP, DP) 1.4, FORD Focus II Hatchback (DA_, HCP, DP) 1.8 TDCi, FORD Focus II Hatchback (DA_, HCP, DP) 2.5 ST, FORD Focus II Hatchback (DA_, HCP, DP) 1.8 Flexifuel, FORD Focus II Hatchback (DA_, HCP, DP) 1.8, FORD Focus II Hatchback (DA_, HCP, DP) 2.5 RS, FORD Focus II Hatchback (DA_, HCP, DP) 2.0 CNG, FORD Focus II Hatchback (DA_, HCP, DP) 2.0 LPG, FORD Focus II Hatchback (DA_, HCP, DP) 1.6 LPG, FORD Focus II Hatchback (DA_, HCP, DP) 2.5 RS 500, (+ 1)


The steps may slightly vary depending on the car design.

This tutorial was created based on the replacement procedure for a similar car part on: FORD Focus II Saloon (DB_, FCH, DH) 1.6 TDCi

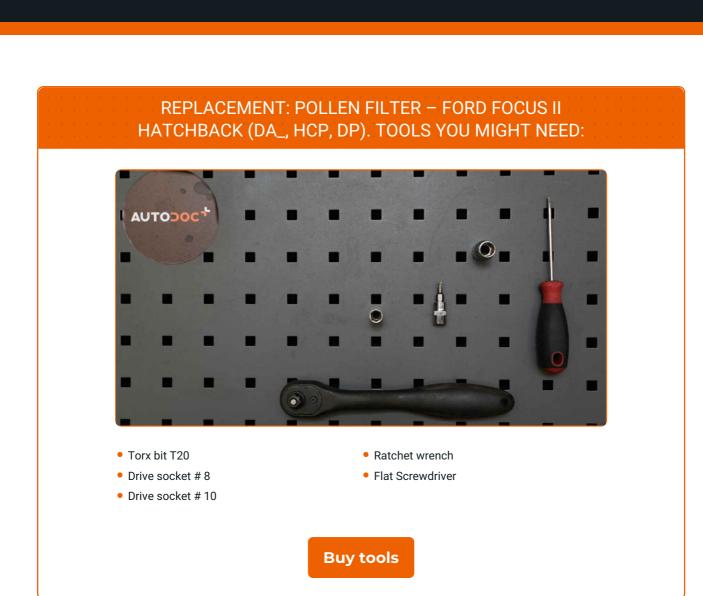

O



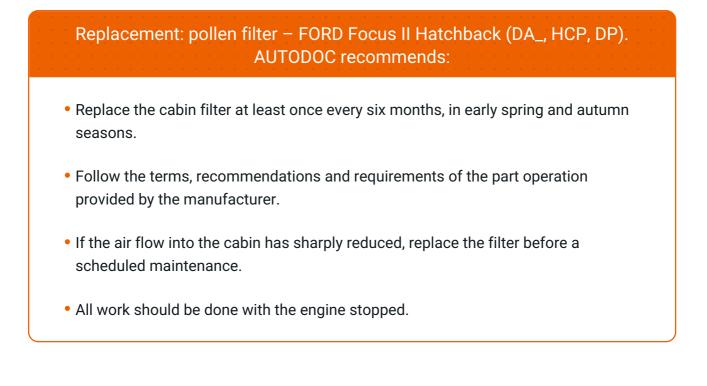

REPLACEMENT: POLLEN FILTER – FORD FOCUS II HATCHBACK (DA_, HCP, DP). RECOMMENDED SEQUENCE OF STEPS:



Remove the caps from the fasteners of the plastic side panel. Use a flat screwdriver.





Unscrew the fasteners of the side plastic trim panel. Use Torx T20.





Remove the side plastic cover.

4

Unscrew the fastener of the accelerator pedal and move it aside. Use a drive socket #10. Use a ratchet wrench.



5

Detach the accelerator pedal connector.



6

Remove the accelerator pedal.



7

Unscrew the fasteners of the cabin filter housing cover. Use a drive socket #8. Use a ratchet wrench.





Remove the cabin filter housing cover.



AUTODOC recommends:

 Replacement: pollen filter – FORD Focus II Hatchback (DA_, HCP, DP). Do not use excessive force when removing the part as this may damage it.

9

Remove the cabin filter.



Replacement: pollen filter – FORD Focus II Hatchback (DA_, HCP, DP). AUTODOC recommends:

• Do not attempt to clean and reuse the filter - it will affect the quality of air cleaning inside the car.



Install the cabin filter to its mounting seat.



Replacement: pollen filter – FORD Focus II Hatchback (DA_, HCP, DP). AUTODOC experts recommend:

- Check out the correct location of the filter element. Do not skew.
- Follow the air flow direction arrow on the filter.
- FORD Focus II Hatchback (DA_, HCP, DP) It's important to only use high-quality filters.

11

Reinstall the cabin filter housing cover.



12

Screw in the fasteners of the cabin filter housing cover. Use a drive socket #8. Use a ratchet wrench.



+ AUTODOC CLUB



13

Attach the accelerator pedal connector.



14

Reinstall the accelerator pedal.



15

Return the accelerator pedal to its initial position and screw in its fastener. Use a drive socket #10. Use a ratchet wrench.



16

Install the side plastic panel.



+ AUTODOC CLUB





Screw the fasteners of the side plastic trim panel. Use Torx T20.



18 19 20

Reinstall the caps on the fasteners of the plastic side panel.

- Switch on the ignition.
- Switch on the air conditioning system. This is necessary in order to make sure that the component operates properly.




Switch off the ignition.



VIEW MORE TUTORIALS



AUTODOC – TOP QUALITY AND AFFORDABLE CAR PARTS ONLINE

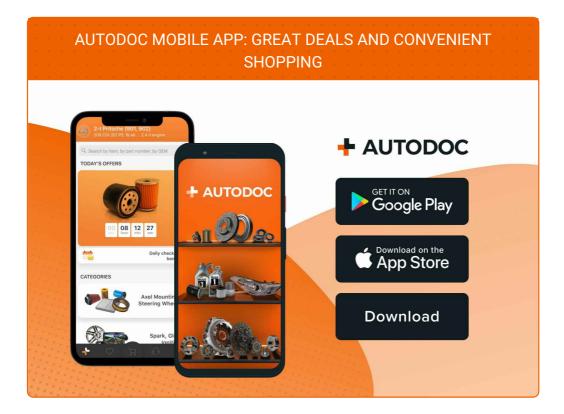

A GREAT SELECTION OF SPARE PARTS FOR YOUR CAR

POLLEN FILTER: A WIDE SELECTION

(i) **DISCLAIMER**:

The document contains only general recommendations that may be useful for you when you perform repair or replacement work. AUTODOC shall not be liable for any loss, injury, damage of property occurring in the repair or replacement process due to incorrect use or misinterpretation of the provided information.

AUTODOC shall not be liable for any possible mistakes and uncertainties in this guide. The information provided is for information purposes only and cannot replace advice from specialists.

AUTODOC shall not be liable for incorrect or hazardous usage of equipment, tools and car parts. AUTODOC strongly recommends to be careful and observe the safety rules when performing repair or replacement works. Remember: usage of low quality auto parts does not guarantee you the appropriate level of road safety.

© Copyright 2023 – All the contents of this website, in particular texts, photographs and graphics, are protected by copyright. All rights, including reproduction, publication, editing and translation rights, are reserved by AUTODOC SE.