



How to change pollen
filter on **VAUXHALL**
Meriva Mk I (A) (X03) –
replacement guide

SIMILAR VIDEO TUTORIAL



This video shows the replacement procedure of a similar car part on another vehicle

Important!


This replacement procedure can be used for:

VAUXHALL Meriva Mk I (A) (X03) 1.7 DTI, VAUXHALL Meriva Mk I (A) (X03) 1.6 i, VAUXHALL Meriva Mk I (A) (X03) 1.6 i 16V, VAUXHALL Meriva Mk I (A) (X03) 1.8 i 16V, VAUXHALL Meriva Mk I (A) (X03) 1.7 CDTI, VAUXHALL Meriva Mk I (A) (X03) 1.3 CDTI, VAUXHALL Meriva Mk I (A) (X03) 1.6 Turbo, VAUXHALL Meriva Mk I (A) (X03) 1.4 16V Twinport, VAUXHALL Meriva Mk I (A) (X03) 1.6 i 16V Twinport

The steps may slightly vary depending on the car design.

This tutorial was created based on the replacement procedure for a similar car part on: OPEL Meriva A (X03) 1.6 16V (E75)

REPLACEMENT: POLLEN FILTER – VAUXHALL MERIVA
MK I (A) (X03). TOOLS YOU MIGHT NEED:

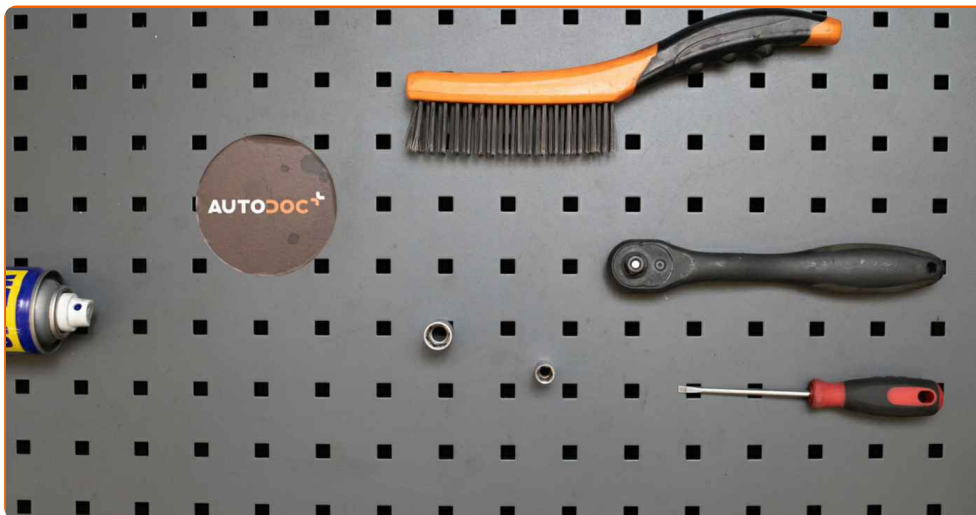

- Wire brush
- WD-40 spray
- Torque wrench
- Drive socket # 8
- Drive socket # 13
- Ratchet wrench
- Flat Screwdriver
- Fender cover

Buy tools

Replacement: pollen filter – VAUXHALL Meriva Mk I (A) (X03). AUTODOC recommends:


- Replace the cabin filter at least once every six months, in early spring and autumn seasons.
- Follow the terms, recommendations and requirements of the part operation provided by the manufacturer.
- If the air flow into the cabin has sharply reduced, replace the filter before a scheduled maintenance.
- Please note: all work on the car – VAUXHALL Meriva Mk I (A) (X03) – should be done with the engine switched off.

CARRY OUT REPLACEMENT IN THE FOLLOWING ORDER:


1 Open the bonnet.

2 Use a fender protection cover to prevent damaging paintwork and plastic parts of the car.

3 Remove the windscreen wiper arm nut covers. Use a flat screwdriver.

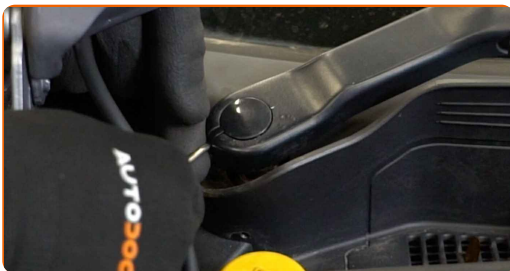


4 Clean the fasteners of the wiper arms. Use a wire brush. Use WD-40 spray.

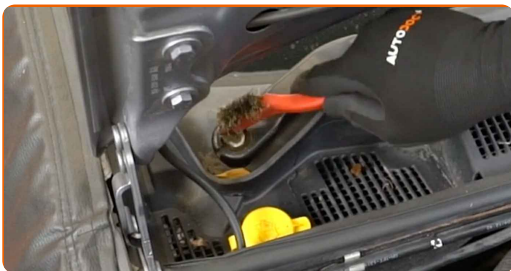


5 Unscrew the fasteners of the windscreen wiper arms. Use a drive socket #13. Use a ratchet wrench.



6 Remove the wiper arms.

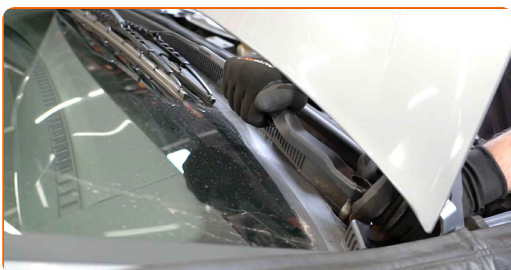


7 Unscrew the fasteners of the cowl grille. Use a drive socket #8. Use a ratchet wrench.

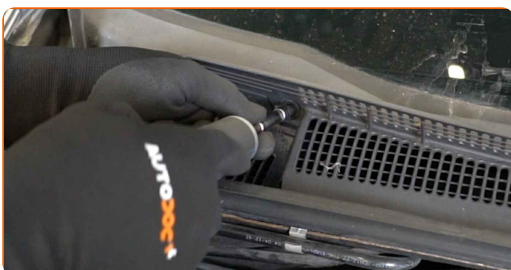


8 Remove the cowl grille seal.



9 Unscrew the fasteners of the windscreen wiper scuttle tray. Use a drive socket #8. Use a ratchet wrench.

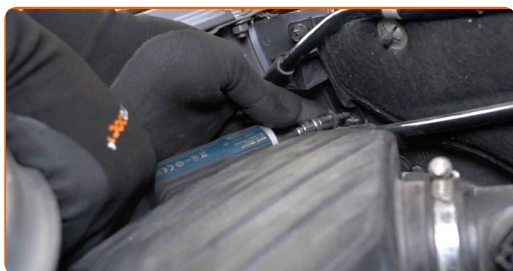

10 Release the engine bulkhead panel clips.

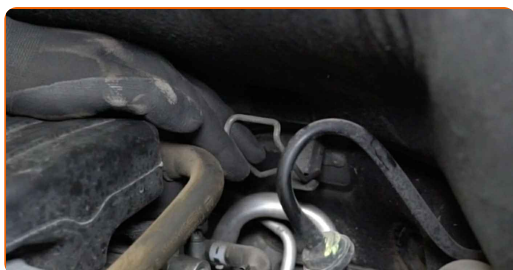

11 Raise up and remove the cowl grille.



12 Unscrew the fasteners of the windscreen wiper scuttle tray. Use a drive socket #8. Use a ratchet wrench.




13 Remove the windscreen wiper scuttle tray.



14 Release the cabin filter cover clips.



15 Remove the cabin filter housing cover.

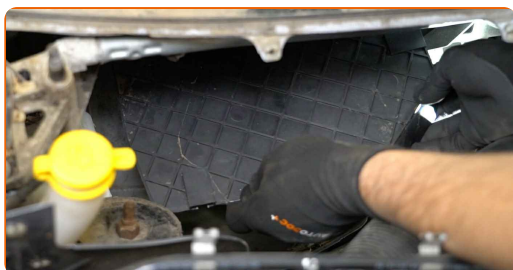

AUTODOC recommends:

- Replacement: pollen filter – VAUXHALL Meriva Mk I (A) (X03). Do not use excessive force when removing the part as this may damage it.

16 Remove the cabin filter.



Replacement: pollen filter – VAUXHALL Meriva Mk I (A) (X03). Tip from AUTODOC experts:

- Do not attempt to clean and reuse the filter - it will affect the quality of air cleaning inside the car.

17 Switch on the ignition.

18 Close the heater flap.


19 Switch off the ignition.

20 Clean the cabin filter housing and cover.

AUTODOC recommends:

- Remove any debris from the cabin filter housing carefully to prevent contamination of the ventilation duct.

21 Install the cabin filter to its mounting seat.

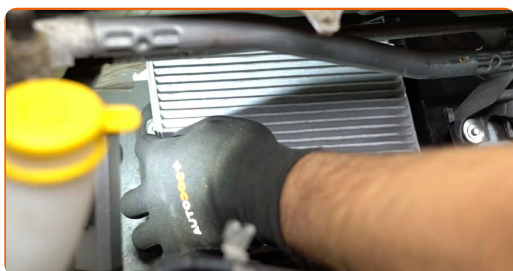

Replacement: pollen filter – VAUXHALL Meriva Mk I (A) (X03). AUTODOC experts recommend:

- Follow the air flow direction arrow on the filter.
- Check out the correct location of the filter element. Do not skew.
- Attention! Use quality filters – VAUXHALL Meriva Mk I (A) (X03).


22

Install the cabin filter housing cover. Make sure you hear a click indicating that it is locked in place.



23

Attach the cabin filter cover clips.

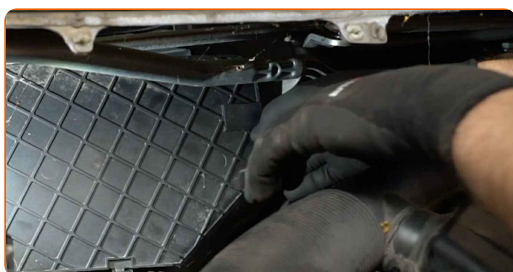


24

Install the windscreen wiper scuttle tray.



25 Screw in the fasteners of the windscreen wiper scuttle tray. Use a drive socket #8. Use a ratchet wrench.

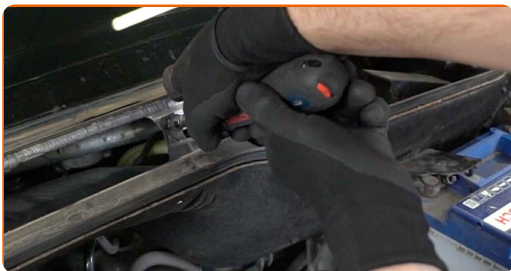

26 Snap the engine bulkhead panel clips into place.

27 Install and secure the cowl grille. Use a drive socket #8. Use a ratchet wrench.



28 Install the cowl grille seal.



29 Reinstall the wiper arms.



Replacement: pollen filter – VAUXHALL Meriva Mk I (A) (X03). Professionals recommend:

- Make sure not to mix up the wiper arms on the driver's and passenger's sides.

30 Tighten the wiper arm fasteners. Use a drive socket #13. Use a torque wrench. Tighten it to 22 nm torque.



31 Install the nut covers of the windscreen wiper arms.

32 Remove the fender protection cover.

33 Close the hood.

34 Switch on the ignition. The heater flap will automatically return to its normal position.

35 Switch on the air conditioning system. This is necessary in order to make sure that the component operates properly.

36 Switch off the ignition.

WELL DONE! 

VIEW MORE TUTORIALS

AUTODOC – TOP QUALITY AND AFFORDABLE CAR PARTS ONLINE

AUTODOC MOBILE APP: GREAT DEALS AND CONVENIENT SHOPPING



A GREAT SELECTION OF SPARE PARTS FOR YOUR CAR

POLLEN FILTER: A WIDE SELECTION

(i) DISCLAIMER:

The document contains only general recommendations that may be useful for you when you perform repair or replacement work. AUTODOC shall not be liable for any loss, injury, damage of property occurring in the repair or replacement process due to incorrect use or misinterpretation of the provided information.

AUTODOC shall not be liable for any possible mistakes and uncertainties in this guide. The information provided is for information purposes only and cannot replace advice from specialists.

AUTODOC shall not be liable for incorrect or hazardous usage of equipment, tools and car parts. AUTODOC strongly recommends to be careful and observe the safety rules when performing repair or replacement works. Remember: usage of low quality auto parts does not guarantee you the appropriate level of road safety.

© Copyright 2023 – All the contents of this website, in particular texts, photographs and graphics, are protected by copyright. All rights, including reproduction, publication, editing and translation rights, are reserved by AUTODOC SE.