- AUTODOC CLUB

How to change engine oil and filter on **VW Touran ITI IT2** – replacement guide



VIDEO TUTORIAL



(i) Important!

This replacement procedure can be used for:

VW Caddy III Van (2KA, 2KH, 2CA, 2CH) 1.9 TDI 4motion, VW Passat Variant (3C5) 2.0 TDI, VW Golf IV Hatchback (1J1) 2.3 V5, VW TIGUAN (5N_) 2.0 TDI 4motion, VW SHARAN (7M8, 7M9, 7M6) 2.0 TDI, VW Bora Saloon (1J2) 2.3 V5, VW Lupo (6X1, 6E1) 1.2 TDI 3L, VW Golf IV Hatchback (1J1) 2.8 V6 4motion, VW Passat CC (357) 3.6 FSI 4motion, VW Passat CC (357) 3.6 FSI, VW Bora Variant (1J6) 2.3 V5, VW Bora Saloon (1J2) 2.8 V6 4motion, VW Golf IV Hatchback (1J1) 2.3 V5 4motion, VW Bora Saloon (1J2) 2.3 V5 4motion, VW Bora Variant (1J6) 2.3 V5 4motion, VW Bora Saloon (1J2) 2.3 V5 4motion, VW Bora Variant (1J6) 2.3 V5 4motion, (+ 103)

The steps may slightly vary depending on the car design.



BUY TOOLS

4

O



Replacement: engine oil and filter – VW Touran 1T1 1T2. AUTODOC experts recommend:

- Replace the oil filter every time when changing motor oil.
- Wear gloves to prevent contact with hot liquid.
- All work should be done with the engine stopped.

REPLACEMENT: ENGINE OIL AND FILTER – VW TOURAN 1T1 1T2. USE THE FOLLOWING PROCEDURE:



Open the hood.



2

Use a fender protection cover to prevent damaging paintwork and plastic parts of the car.



3

Unscrew the oil filler plug.



+ AUTODOC CLUB



4

Clean the oil filter. Use all-purpose cleaning spray.



5

Unscrew the filter housing cap together with the old filter element. Use a drive socket #32. Use a ratchet wrench.



6

Prepare a container for the old oil filter.



7

Remove the filter element from the filter housing. Put the old filter cartridge in the container.





Lift the car using a jack or place it over an inspection pit.



Replacement: engine oil and filter – VW Touran 1T1 1T2. AUTODOC recommends:

- The vehicle must be on even keel, and if it is at an angle, the drain plug must be at the lowest point.
- All work should be done with the engine stopped.

9

Undo the fasteners of the oil pan lower cover. Use Torx T25.



10

Remove the oil pan cover.





Put a waste oil container with at least 5 l capacity under the drainage hole.



12

Clean the area of the oil pan drainage hole. Use a wire brush. Use WD-40 spray.



13

Unscrew the drain plug. Use a combination spanner #19. Use a ratchet wrench.



14

Drain the used oil.





Replacement: engine oil and filter – VW Touran 1T1 1T2. AUTODOC experts recommend:

- Caution! The oil may be hot.
- Wait until the oil has completely drained from the drainage hole.
- 15

Clean the area of the oil pan drainage hole.



16 Screw in the new drainage plug and tighten it. Use a drive socket #19. Use a torque wrench. Tighten it to 30 Nm torque.



17

Clean the area of the oil pan drainage hole. Use all-purpose cleaning spray.





Reinstall the oil pan lower cover.



19

Tighten the fasteners of the oil pan lower cover. Use Torx T25. Use a ratchet wrench.



20

Lower the car.



21

Remove the oil filter cover O-ring. Use a flat screwdriver.



22

Detach the oil filter from the filter cover.





Clean the oil filter housing cap. Use all-purpose cleaning spray.



24

Install a new O-ring to its mounting seat on the filter cover.



25

Screw the new filter into its place.



Please note!

• Make sure to install the filter correctly. Don't mix up the sides of the part.



Lubricate the rubber seal of the new filter with a little amount of fresh oil.





Install a new oil filter housing cover and tighten it. Use a drive socket #32. Use a torque wrench. Tighten it to 25 Nm torque.



28

Remove the oil filler cap. Insert the funnel.



29

Pour oil into the engine through the filler. Required amount of oil: 4.2 l.



Replacement: engine oil and filter - VW Touran 1T1 1T2. Tip:

• Use the oil recommended by the manufacturer.



Check the oil level using the dipstick. Top up oil if necessary.





Please note!

• The oil level should be between the Min and Max marks.



Install the oil filler cap. Tighten the oil filler cap.




32

Run the engine for a few minutes. After the oil pressure warning light goes out, stop the engine.



33

Check the oil level 5 minutes after the stop of the engine operation using a dipstick and add oil if necessary.

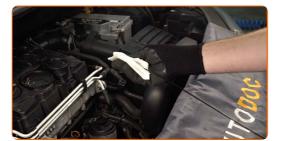



Please note!

- The oil level should be between the Min and Max marks.
- Make sure that the oil filler cap is properly tightened.
- Check the threaded plug of the drainage hole and the oil filter seal for tightness. If necessary, carefully tighten them up.



Remove the fender protection cover.





Close the hood.





Replacement: engine oil and filter – VW Touran 1T1 1T2. Tip from AUTODOC experts:


- Note that oil pressure warning light, which indicates insufficient pressure in the lubrication system, may be on for a longer time than usual. After a few seconds, the oil will fill all the channels, and the light will go out.
- To protect the environment from pollution, be sure to dispose of the used filters at special collection points.



VIEW MORE TUTORIALS



AUTODOC – TOP QUALITY AND AFFORDABLE CAR PARTS ONLINE

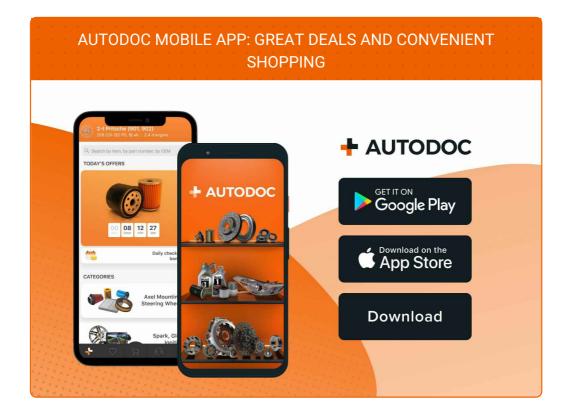

A GREAT SELECTION OF SPARE PARTS FOR YOUR CAR

BUY SPARE PARTS FOR VW

OIL FILTER: A WIDE SELECTION



CHOOSE CAR PARTS FOR VW TOURAN 1TI 1T2

OIL FILTER FOR VW: BUY NOW

OIL FILTER FOR VW TOURAN 1T1 1T2: THE BEST DEALS & OFFERS

(i) **DISCLAIMER**:

The document contains only general recommendations that may be useful for you when you perform repair or replacement work. AUTODOC shall not be liable for any loss, injury, damage of property occurring in the repair or replacement process due to incorrect use or misinterpretation of the provided information.

AUTODOC shall not be liable for any possible mistakes and uncertainties in this guide. The information provided is for information purposes only and cannot replace advice from specialists.

AUTODOC shall not be liable for incorrect or hazardous usage of equipment, tools and car parts. AUTODOC strongly recommends to be careful and observe the safety rules when performing repair or replacement works. Remember: usage of low quality auto parts does not guarantee you the appropriate level of road safety.

© Copyright 2023 – All the contents of this website, in particular texts, photographs and graphics, are protected by copyright. All rights, including reproduction, publication, editing and translation rights, are reserved by AUTODOC SE.