




How to change pollen
filter on **NISSAN**
KUBISTAR (X76) –
replacement guide

SIMILAR VIDEO TUTORIAL

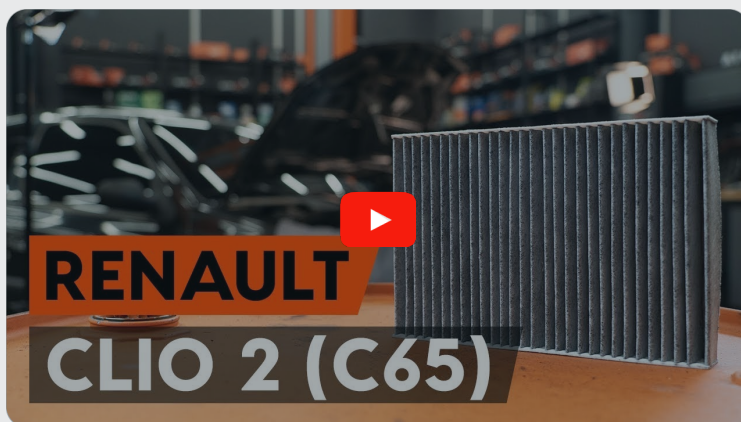

This video shows the replacement procedure of a similar car part on another vehicle

Important!

This replacement procedure can be used for:

NISSAN KUBISTAR (X76) 1.5 dCi, NISSAN KUBISTAR (X76) 1.2 16V, NISSAN KUBISTAR (X76) 1.5 dCi 70, NISSAN KUBISTAR (X76) 1.5 dCi 85

The steps may slightly vary depending on the car design.

This tutorial was created based on the replacement procedure for a similar car part on: RENAULT CLIO II (BB0/1/2_, CB0/1/2_) 1.2

REPLACEMENT: POLLEN FILTER – NISSAN KUBISTAR
(X76). TOOLS YOU NEED:



- All-purpose cleaning spray
- Phillips screwdriver
- Clip removal tool
- Fender cover

[Buy tools](#)

Replacement: pollen filter – NISSAN KUBISTAR (X76). AUTODOC experts recommend:


- Replace the cabin filter at least once every six months, in early spring and autumn seasons.
- Follow the terms, recommendations and requirements of the part operation provided by the manufacturer.
- If the air flow into the cabin has sharply reduced, replace the filter before a scheduled maintenance.
- All work should be done with the engine stopped.

REPLACEMENT: POLLEN FILTER – NISSAN KUBISTAR (X76). USE THE FOLLOWING PROCEDURE:


1 Open the bonnet.

2 Use a fender protection cover to prevent damaging paintwork and plastic parts of the car.

3 Remove the clips of the plastic cowl grille. Use a clip removal tool.

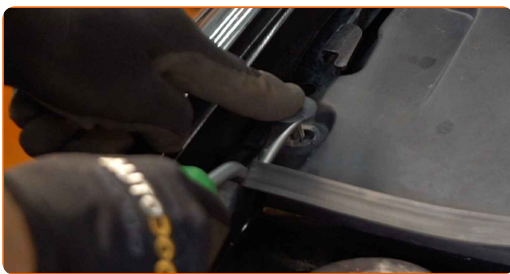

4 Remove the cowl grille seal.

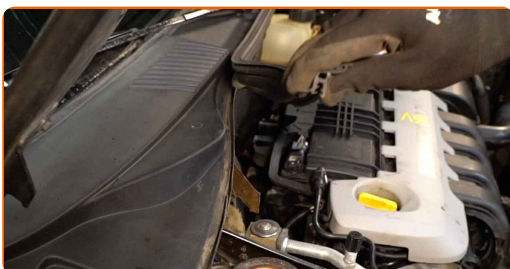


5 Raise up and remove the cowl grille.




6 Clean the cabin filter housing and cover. Use all-purpose cleaning spray.



7 Unscrew the fasteners of the cabin filter housing cover. Use a Phillips screwdriver.

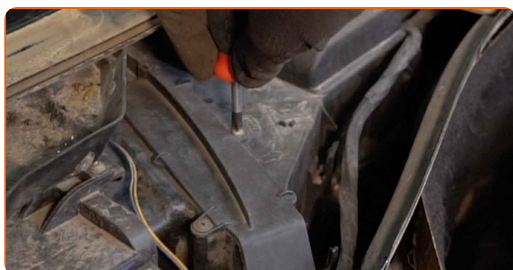

8 Remove the cabin filter housing cover.

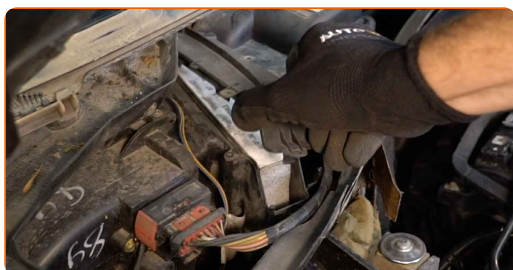

AUTODOC recommends:

- Replacement: pollen filter – NISSAN KUBISTAR (X76). To avoid damaging the part when removing it, do not use excessive force.

9

Remove the filter element from the filter housing.




Replacement: pollen filter – NISSAN KUBISTAR (X76). Tip from AUTODOC:

- Do not attempt to clean and reuse the filter - it will affect the quality of air cleaning inside the car.

10

Insert a new filter element into the filter housing. Make sure that the filter edge fits tight to the housing.

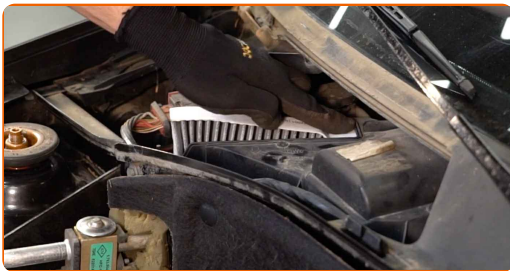


AUTODOC recommends:

- Replacement: pollen filter – NISSAN KUBISTAR (X76). Be sure to position the filtering element correctly. Avoid misalignment.
- Follow the air flow direction arrow on the filter.
- Take care to only use quality filters.


11 Reinstall the cabin filter housing cover.




12 Screw in the fasteners of the cabin filter housing cover. Use a Phillips screwdriver.

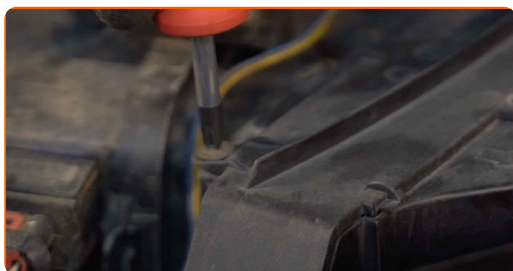

13 Install and secure the cowl grille.

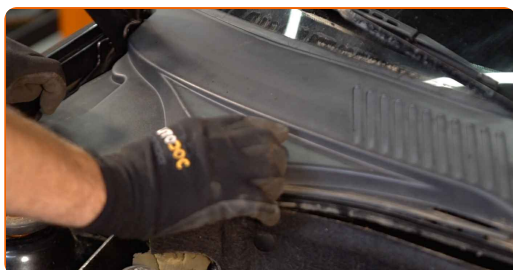

14 Install the fasteners of the wiper plastic cowl grille.

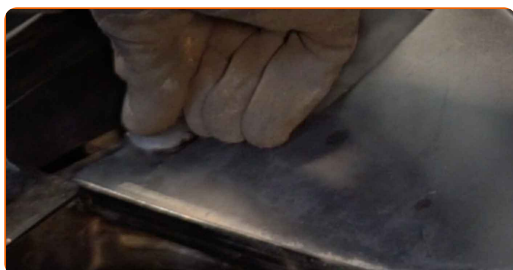

15 Install the cowl grille seal.



- 16** Switch on the ignition.
- 17** Switch on the air conditioning system. This is necessary in order to make sure that the component operates properly.
- 18** Switch off the ignition.
- 19** Remove the fender protection cover.
- 20** Close the hood.

WELL DONE! 

[VIEW MORE TUTORIALS](#)

AUTODOC – TOP QUALITY AND AFFORDABLE CAR PARTS ONLINE

AUTODOC MOBILE APP: GREAT DEALS AND CONVENIENT SHOPPING



+ AUTODOC

GET IT ON
Google Play

Download on the
App Store

Download

A GREAT SELECTION OF SPARE PARTS FOR YOUR CAR

POLLEN FILTER: A WIDE SELECTION

(i) DISCLAIMER:

The document contains only general recommendations that may be useful for you when you perform repair or replacement work. AUTODOC shall not be liable for any loss, injury, damage of property occurring in the repair or replacement process due to incorrect use or misinterpretation of the provided information.

AUTODOC shall not be liable for any possible mistakes and uncertainties in this guide. The information provided is for information purposes only and cannot replace advice from specialists.

AUTODOC shall not be liable for incorrect or hazardous usage of equipment, tools and car parts. AUTODOC strongly recommends to be careful and observe the safety rules when performing repair or replacement works. Remember: usage of low quality auto parts does not guarantee you the appropriate level of road safety.

© Copyright 2022 – All the contents of this website, in particular texts, photographs and graphics, are protected by copyright. All rights, including reproduction, publication, editing and translation rights, are reserved by AUTODOC GmbH.